



BRIGHT COOP, INC.
803 West Seale Street
Nacogdoches, Texas 75964
Phone (936) 564-8378 • Fax (936) 564-3281
Toll Free (800) 562-0730
E-mail info@brightcoop.com




Service Bulletin

Engine Harness Rubbing – BC3-6560 only

Please be aware that there may be an issue with the Kubota intermediate engine harness rubbing on the bracket mounted to the engine. Bright Coop has been notified of several issues in the field, and upon investigation, we have found that the hydraulic hoses may shift and cause this rubbing issue.

We are advising our customers, with a serial number less than 89, to inspect and correct this issue by either moving the harness to the top of the bracket, bending the bracket on the engine to ease the pressure from the hydraulic hoses, or both. The inspection area is on the back side of the engine, just to the right of the swing arm for the steer axle.

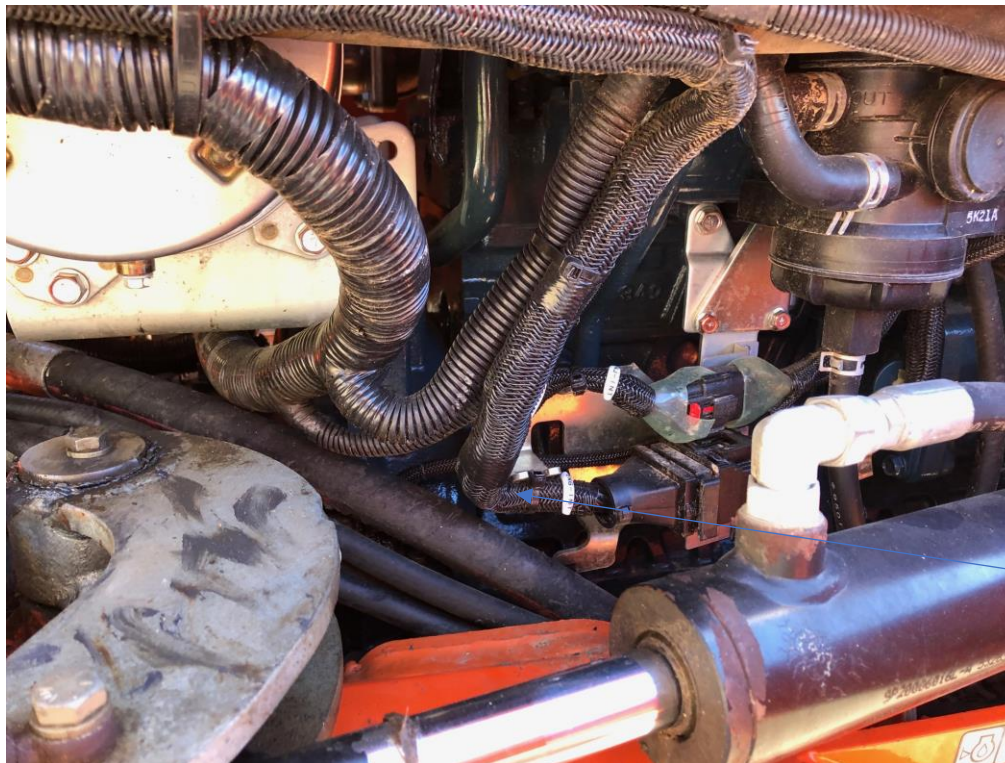

Inspect in this area on the back side of the harness

Please contact Bright Coop at the number above with any questions.

BE BRIGHT

BUY RIGHT

BUY BRIGHT'S

SERVING THE POULTRY INDUSTRY FOR MORE THAN 50 YEARS